

PS型動力押扣起動器

Type PS Manual motor starter

WITH OVERLOAD AND NO. VOLTAGE PROTECTION



PS-111-PW
Specifications



PS-111



PS-211-C


外觀尺寸

Dimensions (mm.)

Surface mounting



PS0, PS1 系列
Series PS0, PS1

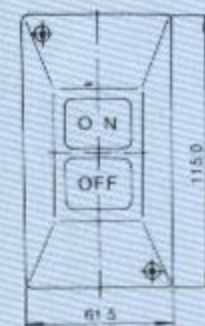

PS2 系列
Series PS2



Type	Applicable motor capacity Kw(HP)				Setting range (A)	Note
	1 φ		3 φ			
	100-120V	200-240V	200-240V	380-440V		
PS211, PS111	0.035 (1/30)	0.05 (1/16)	0.2 (1/2)	0.4 (1/2)	0.9 - 1.2 - 1.5	
	0.1 (1/8)	0.2 (1/4)	0.4 (1/2)	0.75 (1)	1.5 - 2 - 2.6	
	0.2 (1/4)	0.4 (1/2)	0.75 (1)	1.5 (2)	2.6 - 3.5 - 4.4	
	0.4 (1/2)	0.75 (1)	1.5 (2)	3 (4)	4.7 - 6.5 - 8.2	
	0.55 (3/4)	1.1 (1 1/2)	2.2 (3)	3.7 (5)	7 - 9.5 - 12	
PS011	0.75 (1)	1.5 (2)	3.7 (5)	7.5 (10)	-	No protection
PS218, PS118	0.75 (1)	1.5 (2)	3.7 (5)	7.5 (10)	11 - 15 - 19	
PS018	1.1 (1 1/2)	2.2 (3)	5.5 (7 1/2)	11 (15)	-	No protection
PS225, PS125	1.1 (1 1/2)	2.2 (3)	5.5 (7 1/2)	11 (15)	16 - 21 - 26	

Application:

All machines used for motors are applied to Manual motor starters, such as: drilling machine, press, contour machine (band saw), tapping machine, sewing machine, conveyor, packing machine, air compressor, air pump, air conditioner and specific machine. etc.

PS2

: 110V, 220V, 240V, 380V, 415V, and others (AC 50Hz, 60Hz)

Coil voltage of series PS2